

**RESULT OF SPOT CHECK CARRIED OUT WITH TAXI ENFORCEMENT, POLICE & VOSA
AT RIGG ST MOTORS, NELSON, WEDNESDAY 21ST SEPTEMBER 2016**

COMPANY	LICEN CE NO	VEHICLE REG	RESULT	ACTION TAKEN
Ace	PH207	DA58 ZBY	Failed – N/S Tyre tread worn beyond legal limit, O/S Front anti-roll bar link broken. N/S Front suspension arm ball joint holed and ineffective, O/S Front engine and suspension sub frame mounting bolt insecure.	Licence suspended.
Parvez Akhtar	HC33	SD11 VZW	Failed - N/S Front wheel stud missing, wheel nut broken.	Licence suspended.
Street Cars	PH280	DV08 YLL	Failed - CV Gaiter split, split and unable to fulfil its function, O/S inner.	Licence suspended.
Four Star	PH336	KY58 SJD	Failed – O/S Direction indicator inoperative - cannot be used to clearly show the drivers intention.	Licence suspended.
UK Cars	PH384	SA58 TYU	Failed – N/S Front tyre beyond legal limit, antilock brake or electronic stability control warning light indicates existence of a fault.	Licence suspended.
Escort	PH261	PK08 XNS	Failed - N/S Front suspension arm bottom ball joint excessively worn.	Licence suspended.
Matrix	PH271	SA58 XJM	Failed – N/S Front coil spring fractured, antilock brake or electronic stability control warning light indicates existence of a fault, O/S steering rack gaiter damaged.	Licence suspended.
Matrix	PH277	SH08 XKM	Failed – O/S Front tyre beyond legal limit, O/S steering rack gaiter damaged and no longer effective.	Licence suspended.

VIP	PH176	PY58 AHL	Failed – O/S Front shock absorber loose likely to affect steering, excessive movement evident between hub and strut, dangerous to drive.	Licence suspended.
Cavalier	PH251	J7 OCS	Failed – N/S Rear coil spring fractured.	Licence suspended.
A - Line	PH120	FP58 FVS	Failed taxi test – Severe oil leak, bodywork to be repaired, boot not closing properly, rear door cover missing off handle.	Licence suspended.
Higher Up – hired out to Waqar Ahmed	HC614	DU12 DMF	Failed – N/S/R brake pads, severe oil leak.	Licence suspended.
Victors	PH238	TN07 SDX	Passed - Defect notice issued – Oil leak, first aid kit, fire extinguisher missing, no smoking stickers missing.	Defect notice issued.
Yellow Cars	PH144	OV12 NWZ	Passed – O/S/F door sign missing.	Defect notice issued.
Yellow Cars	PH92	BG13 NBY	Passed	
Union	PH337	DY58 DNN	Failed to show up – licence was suspended as could not determine whether the vehicle was fit for use and owner informed the suspension would be lifted once it had undertaken a full taxi test. Attended for test later that day where it failed on N/S/F Anti roll bar link broken and a severe oil leak.	Licence suspended
Crown and Greenline	HC31	AE58 YZF	Failed to show up – licence was suspended as could not determine whether the vehicle was fit for use and owner informed the suspension would be lifted once it had undertaken a full taxi test. Attended for test on 29/09/16	Licence suspended

			where it failed on rear plate deteriorated, N/S/F/R centre caps missing, front lip missing, first aid kit inadequate, fire extinguisher unfit, rear door inner scratch, centre console incomplete, gear nob worn, passenger front window inoperative, N/S door sill damage, car dirty, N/S wing headlamp bumper alignment out, battery tray insecure and O/S/F wheel arch corrosion.	
Alpine	PH133	OV55 VHA	Failed to show up as the vehicle broke down on the way. Tyres inspected on the road where both were below the legal limit with cords showing on one. Attended for a full taxi test the following day where it failed on number plate lights inoperative, O/S track rod end, power steering leak, N/S Rear arm bush worn, O/S/R handbrake cable insecure, battery tray insecure, first aid kit missing, bodywork damaged.	Licence suspended
BCN	PH	VU07 VFR	Failed to show up – seen at Bankhouse Road tyre bay changing front tyre. Licence was suspended as could not determine whether the vehicle was fit for use and owner informed the suspension would be lifted once it had undertaken a full taxi test. Attended for a full test 2 days later where it passed.	Licence suspended.